
Digital Microhmmeter Type D07010

Operating Instructions



Bracken Hill, South West Industrial Estate,
Peterlee, Co. Durham SR8 2SW. England.
Tel: +44 (0)191-586 3511 Fax: +44 (0)191-586 0227
www.cropico.co.uk
sales@cropico.co.uk

Limited Warranty & Limitation of Liability

CROPICO guarantees this product for a period of 1 year. The period of warranty will be effective at the day of delivery.

(c) Copyright 2011

All rights reserved. Nothing from this edition may be multiplied, or made public in any form or manner, either electronically, mechanically, by photocopying, recording, or in any manner, without prior written consent from CROPICO. This also applies to accompanying drawings and diagrams.

Due to a policy of continuous development CROPICO reserves the right to alter the equipment specification and description outlined in this publication without prior notice and no part of this publication shall be deemed to be part of any contract for the equipment unless specifically referred to as an inclusion within such contract.

Disposal of Old Product



This product has been designed and manufactured with high quality materials and components that can be recycled and reused.

When the crossed out wheeled bin symbol is attached to a product it means the product is covered by the European Directive 2002/96/EC.

Please familiarise yourself with the appropriate local separate collection system for electrical and electronic products.

Please dispose of this product according to local regulations. Do not dispose of this product along with normal waste material. The correct disposal of this product will help prevent potential negative consequences for the environment and human health.

User Note:

These Operating Instructions are intended for the use of Competent Personnel.

SECTION 1 : INTRODUCTION – SPECIFICATIONS.....	4
MEANING OF THE DIFFERENT SYMBOLS ON THE INSTRUMENT.....	4
1-1 MAIN SPECIFICATIONS:.....	5
1-1-1 Presentation.....	5
1-1-2 Functions and specifications.....	5
1-1-3 Power supply.....	5
1-2 TECHNICAL SPECIFICATIONS:.....	6
1-2-1 Front panel.....	6
1-2-2 Measurement ranges.....	7
1-2-3 Manual or auto triggering mode.....	7
1-2-4 Measurement quality control.....	7
1-2-5 SEQUENCE mode.....	8
1-2-6 RS232 serial interface:.....	8
1-2-7 Power supply.....	9
1-2-8 Unit Dimensions.....	9
1-2-9 Weight.....	9
1-2-10 Remote Control Unit (RCU) specifications (DO7010-REM).....	10
1-2-10-1 Data transfer between PC and the Remote Control Unit (RCU):.....	11
1-2-10-2 Remote Control Unit presentation :.....	11
1-2-11 Data transfer between PC computer and the DO7010.....	12
1-2-12 Wiring schematic between PC, DO7010 and DO7010-REM.....	13
1-3 OPTIONS AND ACCESSORIES:.....	14
1-4 MEASUREMENT METHOD:.....	15
SECTION 2: BATTERY CHARGER AND ACCESSORIES OPERATION	16
2-1 Battery charger operation:.....	16
2-1-1 Battery charge in the DO7010:.....	16
2-1-2 Battery charge outside of the DO7010:.....	17
2-2 Accessories connection:.....	17
SECTION 3: DO7010 CONFIGURATION	18
3-1 LCD screen setup: the contrast.....	19
3-2 LCD screen setup: the backlight.....	19
3-3 Auto switch off mode :.....	20
3-4 Keys sound level:.....	20
3-5 Alarm sound level:.....	21
3-6 Measurement trigger mode :.....	21
3-7 Date setup:.....	22
3-8 Time setup:.....	22
3-9 Language selection:.....	23
3-10 Mains frequency selection :.....	23
3-11 Calibration access code:.....	24
3-12 DO7010 AUTOTEST:.....	24

SECTION 4: OPERATING THE DO7010 IN MANUAL MODE..... 26

4-1 MANUAL mode parameters: 26

4-1-1 Measurement range selection: 27

4-1-2 Measurement current selection: 27

4-1-3 Thermal EMF Error:..... 28

4-1-4 Log mode: 29

4-1-5 The limit function: 30

4-2 Measurements in MANUAL mode: 31

4-3 Measurements in MANUAL mode with the limit function: 31

4-4 Measurement in MANUAL mode with the log mode: 32

SECTION 5: SEQUENCE MODE 33

5-1 Measurement protocol selection: 34

5-2 Measurement protocol header display:..... 35

5-3 First measurement of the protocol: 35

5-3-1 Example of a PASS measurement: 36

5-3-2 Direct access to a test step: 36

5-3-3 Example of a FAIL measurement: 37

5-3-4 Example of an ABSENT point: 37

5-3-4 Example of an OVER measurement: 38

5-4 Sequence end: 38

SECTION 6 SERVICE and CALIBRATION : 39

6.1 PRELIMINARY 39

6.2 INSTRUMENT RETURN 39

6.3 SERVICE..... 39

6.4 CLEANING 39

6.5 CALIBRATION..... 39

SECTION 1: INTRODUCTION - SPECIFICATIONS



Warning: This unit must be used by qualified people. Every precaution for the use of units connected to the mains must be taken during its use.

The specifications of this manual, the correct operation of the unit, as well as the operator's security are guaranteed only when the supplied accessories are used. The measurement probes can include limitation or protective elements, therefore it is forbidden to modify without written agreement from CROPICO.

In case of use under other conditions than the one specified in this manual, the safety of the user will be in danger.

MEANING OF THE DIFFERENT SYMBOLS ON THE INSTRUMENT

	Warning (See document attached)
	Warning, risk of electric shock.
	DC voltage.
	AC and DC voltages.
	AC voltage.
	Earth connection.

1-1 MAIN SPECIFICATIONS:



1-1-1 Presentation

- Robust case, dust and water proof.
- Portable device, light in weight and with carrying strap.
- Option: a case to store the unit, its accessories and measurement leads.

1-1-2 Functions and specifications

- 4 measurement ranges: $6\text{m}\Omega$, $60\text{m}\Omega$, $600\text{m}\Omega$, $6000\text{m}\Omega$
- Auto or manual range selection
- Measurement current: 100mA, 1A , 10A
- Impulse current pulse with 100msec. width
- 6000 digits LCD display
- Measurement accuracy: $\pm 0.1\%$ (reading + 0.1% full scale)
- Measurement threshold with adjustable low and high limits
- Alarm beeper
- 999 piece memory with measurement results, date, and time.
- Bi-directional transfers for test sequence and measurement results on a PC under excel format files.
- RS232 serial interface to download data between the DO7010 and a PC.
- Remote Control Unit with LCD display (similar to the DO7010 main unit display) and memory.
- RS232 serial interface for the handshake between the RCU and the DO7010 from 3 up to 15 meters.

1-1-3 Power supply

- Removable Nickel Metal Hydride (NiMH) battery pack; 3 AH Capacity
- External universal battery charger
- 2 charging mode: fast and trickle
- A fully charged battery pack allows 1000 measurements @10A.
- For energy saving the DO7010 switches off the LCD backlight after a time adjustable in the SETUP menu, with automatic switch on when pressing any key. Even without backlight the display stays readable.

1-2 TECHNICAL SPECIFICATIONS:

1-2-1 Front panel

Main display on the unit:

- 64 x 240 points LCD matrix (liquid crystal display) with electroluminescent diode backlight.
- 6000 digit measurement and location test point display with large characters and small characters for:
 - units
 - measurement range
 - measurement current
 - battery charge level
 - error code (measurement, polarity...)

Keyboard:

- 5 function keys changing according to the menus.
- 4 navigation keys: arrows UP, DOWN, RIGHT, LEFT.
- 1 data enter key
- 1 software power ON key
- 1 mechanical key to trigger the measurement.

Visual and audible signal:


- Audible signal when pressing keyboard (can be disabled)
- Audible signal with error message and FAIL measurements
- Red and Green LEDS for PASS/FAIL measurement results.

Measurement connection:

- 2 circular connectors (3 and 4 pins) with locking system from JAEGER

RS232 interface:

- sub-D 9 pins connector for PC and RCU connection

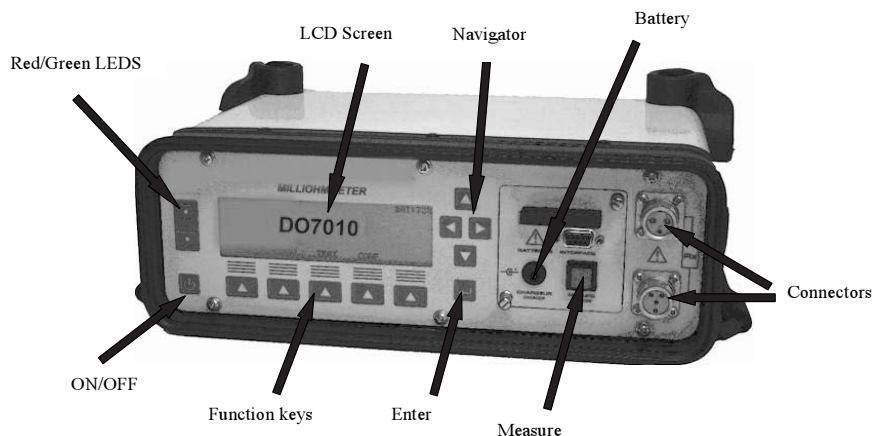

1-2-2 Measurement ranges

The DO7010 measuring capacity is made by 4 resistance ranges manually or automatically selected:

Range	Current	Resolution	Accuracy
6mΩ	1A / 10A	1μΩ	(0,1% read + 0,1% FS)
60mΩ	1A / 10A	10μΩ	(0,1% read + 0,1% FS)
600mΩ	1A / 10A	100μΩ	(0,1% read + 0,1% FS)
6000mΩ	0,1A / 1A	1mΩ	(0,1% read + 0,1% FS)

read = reading FS = Full scale

Each measurement range can be operated with 2 currents (high and low currents) selected by the operator. The current generator is permanently controlled by the microprocessor, and an error message is displayed if the current is out of specs. The maximum current value cannot exceed +10% of the rated value.

1-2-3 Manual or auto triggering mode

In MANUAL triggering mode, by pressing on the mechanical push button MEASURE, the unit starts a measurement cycle generating a short current pulse and allowing the voltage drop across the resistor to be measured. Using the Ohm's law ($R = U / I$), the unit computes the resistance value and displays the result on the LCD screen.

In AUTO triggering mode, the measurement is triggered by detecting the current flowing through the specimen under test.

The triggering mode is set in the SETUP menu.

1-2-4 Measurement quality control

- Cancellation of thermal EMF errors is done either by the ZERO mode method, consisting of a measurement without current, followed by a measurement with current from which unwanted voltages are subtracted, or by the AVERAGE mode method consisting of two measurements, one with positive current and one with negative current, and the result is the average of the two.
- The maximum lead resistance for the current leads on the 6mΩ range is 170mΩ.
- AUTOTEST is automatically performed at each unit power on, and a calibration check can be done with the TEST function.
- When a measurement default occurs (bad accessory contact, too high resistance for the range, etc...) a warning message, which is clear and easy to understand, is displayed on the LCD screen.

1-2-5 SEQUENCE mode

In SEQUENCE mode, the DO7010 is able to store 999 measurements with location number, limit, current, resistance, date, time, and operator ID according to a protocol written under an excel file format. The excel file is created on a PC and then downloaded to the DO7010.

Protocol header:

- Operator name : T DURANT
- ID: NT76207521
- Date: 02/10/03
- Plane no: 1234567

Each protocol line includes:

- Mechanical drawing no: 1234567890
- Bounding no: 23
- Threshold value: 5mΩ
- Measurement current : 1 or 10A
- Measurement value: 4,99mΩ

This data is saved even when the main battery pack is fully discharged, and when replacing the battery pack.

The keyboard allows you to quickly select the functions, search for the points to be measured, scrolling the screen pages, etc...

1-2-6 RS232 serial interface:

The DO7010 comes, as standard, with an RS232 serial interface with the following specifications:

- ANSI/EIA/TIA-232-E61991 specs.
- Baud rate : 9600 bauds
- Start bit : 1
- Bit number : 8
- Parity check : no
- Stop bit : 1

Using the RTS and CTS 5 wires mode provides a hardware synchronisation of the serial interface.

The commands to control the unit and the SEQUENCE download are in accordance with the IEEE488-2 standard and follow the SCPI language rules.

1-2-7 Power supply

The DO7010 is powered by an easily removable NiMH battery pack.


Operating time is about 20 hours, or 1000 measurements @10A.

Visual information on the LCD screen with a numerical value in %, gives the battery discharge level.

Plugged in the DO7010 or outside of the DO7010, the battery pack can be recharged with the provided charger connected to the mains (90 -250 volts).

The charge control is fully automatic, and the charge time is less or equal to 3 hours.

Additional battery packs can be purchased separately (DO7010-02)

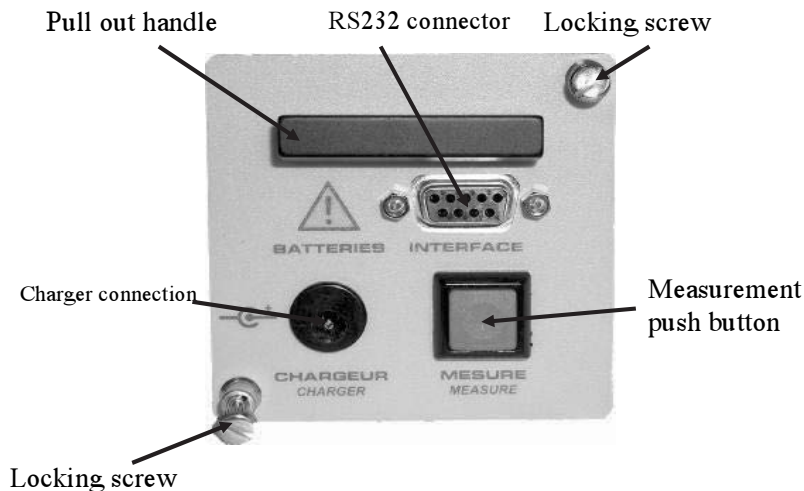

1-2-8 Unit Dimensions

The DO7010 is presented in a grey polyurethane case.

- High : 275mm
- Length : 340mm
- Width : 120mm

1-2-9 Weight

< 4.5 kg

1-2-10 Remote Control Unit (RCU) specifications (DO7010-REM)

On option, the DO7010 unit can work in conjunction with a remote control unit (DO7010-REM)

The DO7010 RCU is made in a shock proof black colour polystyrene case. It includes a 64x240 dot matrix graphic LCD screen with backlight, a beeper, red and green LED, a set of 5 function keys and a 4 direction navigator with an enter key.

The RCU also includes a battery back up memory, allowing uploading measurement results in to a PC computer without having to transport the DO7010 main unit.

The RCU is connected to the DO7010 with a 3 meter long cable, which can be extended to 15 meters.

RCU dimensions:

- Length : 200 mm
- Width : 120 mm
- High : 60 mm

Weight:

- 600 g

Display:

64x240 points LCD matrix (liquid crystal display) with electroluminescent diode backlight.

6000 digit measurement and location test point display in large and small characters for:

- units
- measurement range
- measurement current
- battery charge level
- Error code (measurement, polarity...)

Keyboard:

- 5 function keys changing according to the menus.
- 4 navigation keys: arrows UP, DOWN, RIGHT, LEFT.
- 1 data enter key
- 1 software power ON key
- 1 mechanical key to trigger the measurement.

Visual and audible signal:

- Audible signal when pressing keyboard (can be disabled)
- Audible signal with error message and FAILED measurements
- Red and Green LEDS for PASS/FAIL measurement results.

Battery charge level:

From 0 to 99%

Operation:

The RCU can be operated either by hand, or strapped to the fore arm to make the measurement easier.

1-2-10-1 Data transfer between PC and the Remote Control Unit (RCU):

The DO7010 unit and the RCU (DO7010-REM option) exchange data through a serial RS232 interface.

When the RCU is connected to the DO7010 (with a special cable DO7010-262 provided by CROPICO), the whole control is done from the RCU.

The memorisation of the protocol as well as the measurement results are made in the RCU memory.

When the measurement protocol (complete or partial) is over, the connection cable between the DO7010 and the RCU can be disconnected (on the RCU side). The operator brings the RCU to the data storage PC computer equipped with the DO7010-08 option (RCU/PC adaptor with power supply).

The RCU is connected on the DO7010-08 and the DO7010-PRO software (DO7010-09 option) allows RCU memory transfer into the PC computer.

Then the RCU memory can be cleared and downloaded with a new measurement protocol.

After RCU re-connection to the DO7010 main unit the device is ready to perform the new measurement protocol.

1-2-10-2 Remote Control Unit presentation :

1-2-11 Data transfer between PC computer and the DO7010

The DO7010 unit and the PC exchange data through a serial RS232 interface, with a special cable DO7010-179A provided with DO7010-PRO software (DO7010-09 option).

The operator brings the DO7010 to the data storage PC computer, equipped with the DO7010-179A cable, and downloads a measurement sequence into the DO7010 memory.

The memorisation of the protocol as well as the measurement results are done in the DO7010 unit.


Then, the operator brings the DO7010 into the production area and executes all the measurements.

When the measurement protocol (complete or partial) is over, the operator brings the DO7010 to the data storage PC computer equipped with the DO7010-179A cable.

The DO7010 unit is connected to the DO7010-179A and the DO7010-PRO software (DO7010-09 option) allowing DO7010 memory transfer into the PC computer.

Then the DO7010 memory can be cleared and downloaded with a new measurement protocol.

1-2-12 Wiring schematic between PC, DO7010 and DO7010-REM

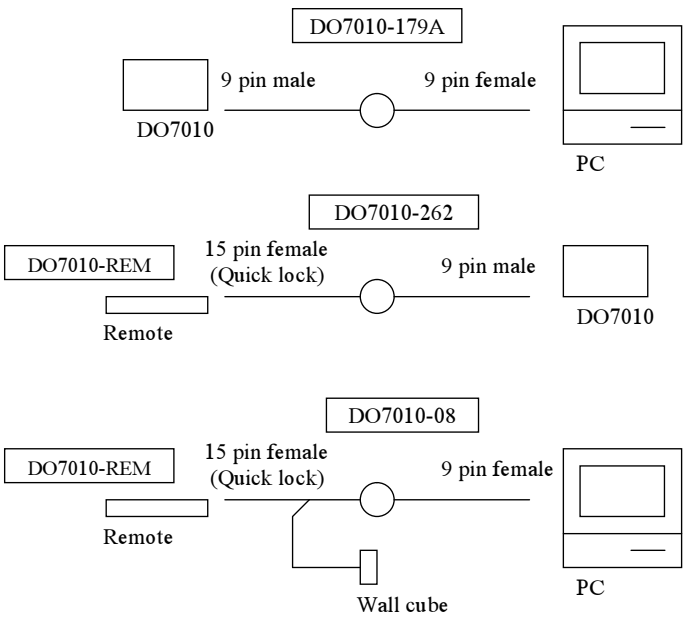

1-3 OPTIONS and ACCESSORIES:

DO7010-REM	Remote Control Unit (RCU) with memory
DO7010-02	Additional battery pack
DO7010-03	Additional battery charger
DO7010-04	12 meters extension cable for Remote control unit & measurement leads (4pts male/ 4pts female)
DO7010-06	15 meters extension cable on reel (3 pts mâle/3 pts female)
DO7010-07	90 meters extension cable on reel with wheels (3 pts mâle/3 pts female)
DO7010-08	RCU / PC adaptor with power supply
DO7010-09	DO7010-PRO software and PC connection cable
DO7010-10	20 meters extension cable on reel with 3 pts male/ 3pts male
DO7010-11	20 meters extension cable on reel with 3 pts male/ 3pts female
DO7010-13	Battery charger with power cord
DO7010-14	Jaeger adaptor 3 pins male to 4 pins female
DO7010-15	Protection lid
DO7010-16	Bag for DO7010 accessories
DO7010-17	Shunt 1 m 0.5 % for DO7010
DO7010-18	Shunt 5 m 0.5 % for DO7010
DO7010-19	Shunt 10 m 0.5 % for DO7010
DO7010-20	Shunt 50 m 0.5% for DO7010
DO7010-21	USB serial adapter to add a serial port on a PC
DO7010-91	Calibration box for DO7010

Lead and probes:

D07010-250	4 wire lead with banana plugs and tips (VN-VG)
DO7010-251	2 wire probe , 4 pins male plug , concentric tips , length = 150mm
DO7010-255	2 wire lead , 3 pins male plug , Kelvin crocodile clip
DO7010-258	2 wire probe , 4 pins male plug , concentric tips , length = 180mm
DO7010-28/1	2 wire probe , 4 pins male plug , parallel tips , length = 180mm , remote control push-button
DO7010-10/1	2 wire lead , 3 pins male plug , large Kelvin crocodile clip


1-4 MEASUREMENT METHOD:

In order to perform high accuracy low resistance measurements, the DO7010 uses a 4 wire method named Kelvin method.

- 2 wires are used to connect a constant current source to the specimen under test
- 2 wires are used to measure the voltage difference directly on the specimen under test terminals.

With this method the measurement leads resistance doesn't introduce error, but should not exceed 170 mΩ for the current connection.

Kelvin method

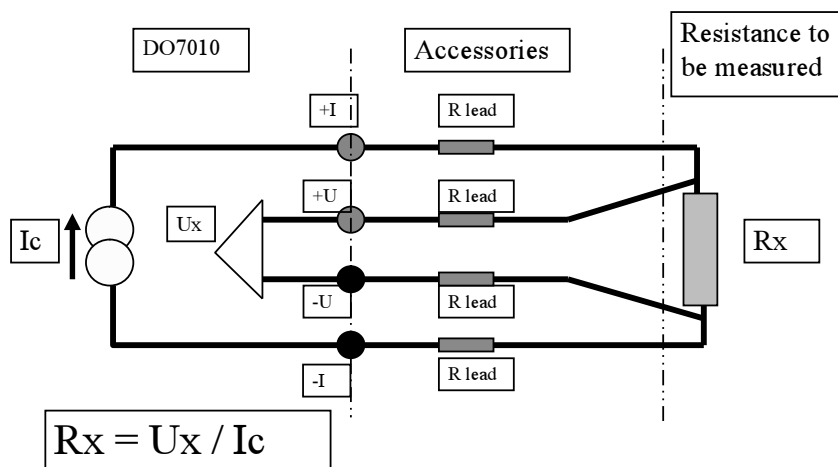


SECTION 2: BATTERY CHARGER AND ACCESSORIES OPERATION

Switch ON the DO7010 by pressing on the key located on the left hand side corner of the front panel (see chapter 1-2-1 Front panel)

2-1 Battery charger operation:



When the battery level indicator gives a value lower than 10%, it is necessary to charge the battery pack or to replace it with a fully charged one.

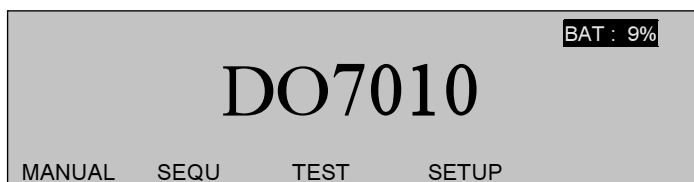


2-1-1 Battery charging in the DO7010:

-  Switch OFF the DO7010 with the ON/OFF key (left hand side on the front panel).
- Connect the charger circular connector in the front panel battery pack terminal named *CHARGER*
- Connect the charger to a mains plug (90- 230 VAC)
- The red lamp on the charger turns on permanently. It will flash to indicate the charge end (< 3 hours)
- Then disconnect the circular connector from the DO7010 front panel.
- Switch ON the DO7010 and check that the battery level gives a value = 99 %

Red lamp

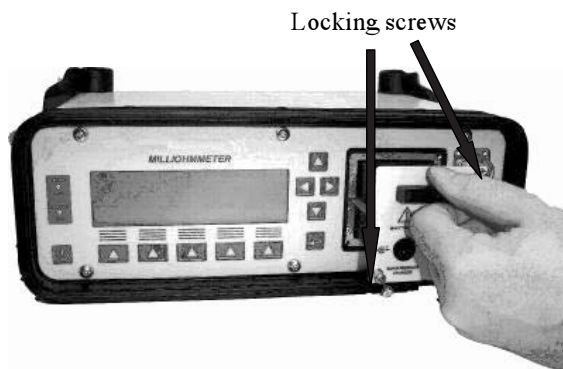


2-1-2 Battery charging outside of the DO7010:

-  Switch OFF the DO7010 with the ON/OFF key (left hand side on the front panel).
- Unscrew the 2 locking screws and pull out the battery pack with the help of the handle.
- Connect the charger circular connector in the front panel battery pack terminal named *CHARGER*
- Connect the charger to a mains plug (90- 230 VAC)
- The red lamp on the charger turns on permanently. It will flash to indicate the charge end (< 3 hours)
- Then disconnect the circular connector from the DO7010 front panel.
- Insert the battery pack and tighten the 2 locking screws.

Switch ON the DO7010 and check that the battery level gives a value = 99 %


2-2 Accessories connection:

- The DO7010 accessories are equipped with 3 or 4 pins JAEGER connectors.
- Check the pin number of your accessory and connect it the right plug.
- Push the connector into the socket and then rotate the stripped collar $\frac{1}{4}$ clockwise to lock.
- Turn the stripped collar $\frac{1}{4}$ anti-clockwise, and pull out the connector to disconnect.

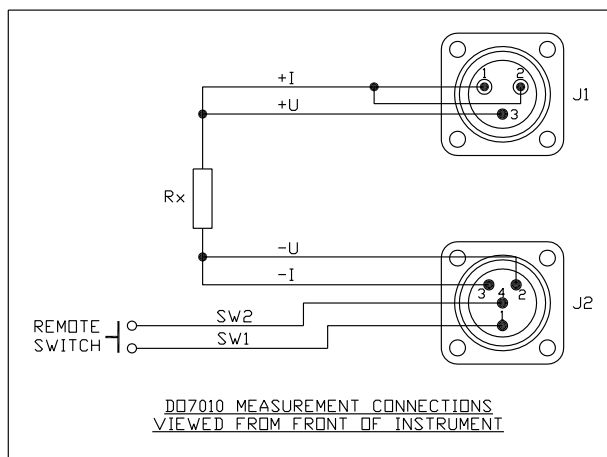

SECTION 3: DO7010 CONFIGURATION


From the power ON screen or from any menu level which allows the operation, press on the SETUP key to reach the DO7010 setup menu.

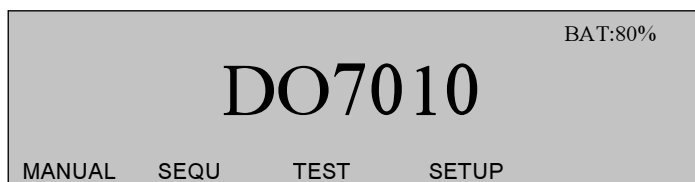

- With the UP and DOWN arrows, move the reverse video area to select the line to modify.
- With the RIGHT arrow or the enter key, enter the menu level to set the parameters.




3-1 LCD screen setup: the contrast

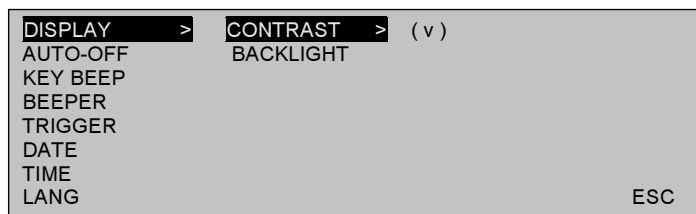

- Select the DISPLAY line
- Press on the RIGHT arrow or on the enter key
- Select the CONTRAST line
- Press on the RIGHT arrow or on the enter key
- Set the LCD contrast with the UP and DOWN arrows.
- Enter the setup either with the LEFT arrow or the Enter key

3-2 LCD screen setup: the backlight

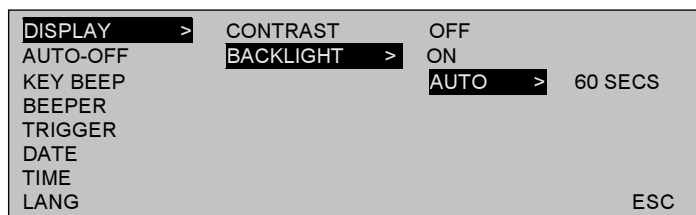

- Select the DISPLAY line
- Press on the RIGHT arrow or on the enter key
- Select the BACKLIGHT line
- Press on the RIGHT arrow or on the enter key
- Select the LED backlight operating mode with the UP and DOWN arrows :
 - ON = permanent (pay ATTENTION to the battery life time!)
 - OFF = without backlight
 - AUTO = set the backlight time from 5 to 60 seconds (by 5 sec. steps) with the RIGHT then UP and DOWN arrows key.
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-3 Auto switch off mode:

DISPLAY	OFF
AUTO-OFF >	ON > 20 MINS
KEY BEEP	
BEEPER	
TRIGGER	
DATE	
TIME	
LANG	ESC

- Select the AUTO-OFF line
- Press on the RIGHT arrow or on the enter key
- Set the automatic switch off mode with the UP and DOWN arrows:
 - OFF= permanent operation mode (pay ATTENTION to the battery life time!)
 - ON = set the time before the unit switch off from 10 to 60 minutes with the RIGHT arrow and then the UP and DOWN arrows.
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-4 Keys sound level:

DISPLAY	OFF
AUTO-OFF	LO
KEY BEEP >	HI
BEEPER	
TRIGGER	
DATE	
TIME	
LANG	ESC

- Select the KEY BEEP line
- Press on the RIGHT arrow or on the enter key
- Set the keys sound level with the UP and DOWN arrows:
 - OFF = no sound when pressing a key
 - LO = low sound level.
 - HI = high sound level
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-5 Alarm sound level:



- Select the BEEPER line
- Press on the RIGHT arrow or on the enter key
- Set the alarm sound level with the UP and DOWN arrows:
 - OFF = no sound when error or failed result
 - LO = low alarm sound level.
 - HI = high alarm sound level
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-6 Measurement trigger mode:



- Select the TRIGGER line
- Press on the RIGHT arrow or on the enter key
- Set the measurement trigger mode with the UP and DOWN arrows:
 - MAN = measurement trigger by the front panel green push button (MEASURE)
 - AUTO = automatic measurement trigger by detection of 100mA current flowing through the specimen under test, then current pulse according to the current setup.
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-7 Date setup:

DISPLAY	ON	
AUTO-OFF	20 MINS	
KEY BEEP	HI	
BEEPER	HI	
TRIGGER	AUTO	
DATE	29/03/04	
TIME	12:13	
LANG	ENG	ESC


- Select the DATE line
- Press on the RIGHT arrow or on the enter key
- Set the Day with the UP and DOWN arrows.
- Move to the Month field with RIGHT arrow.
- Set the Month with the UP and DOWN arrows.
- Move to the Year field with RIGHT arrow.
- Set the Year with the UP and DOWN arrows.
- Confirm the change with Enter key, or go back without change with the ESC arrow

3-8 Time setup:

DISPLAY	ON	
AUTO-OFF	20 MINS	
KEY BEEP	HI	
BEEPER	HI	
TRIGGER	AUTO	
DATE	29/03/04	
TIME	12:13	
LANG	ENG	ESC


- Select the TIME line
- Press on the RIGHT arrow or on the enter key
- Set the Hour with the UP and DOWN arrows.
- Move to the Minute field with RIGHT arrow.
- Set the Minute with the UP and DOWN arrows.
- Confirm the change with Enter key, or go back without change with the ESC arrow

3-9 Language selection:

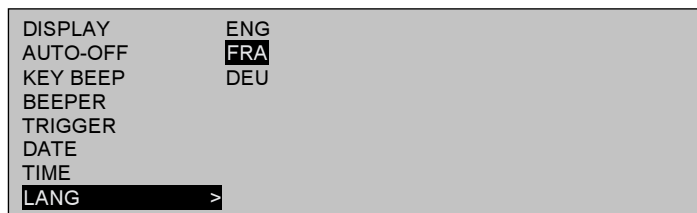

- Select the LANG line
- Press on the RIGHT arrow or on the enter key
- Set the language with the UP and DOWN arrows:
 - ENG = English
 - FRA = Français (French)
 - DEU = Deutsch (German)
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-10 Mains frequency selection:

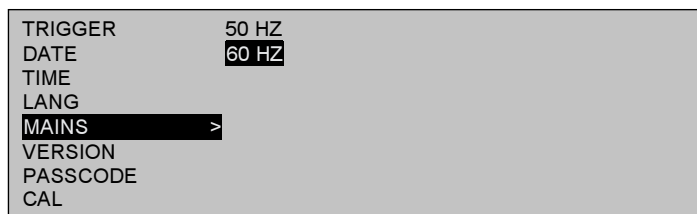

- Select the MAINS line
- Press on the RIGHT arrow or on the enter key.
- Select the mains frequency to optimize the measurement stability with the UP and DOWN arrows:
 - 50HZ = for 50 and 400Hz
 - 60HZ = for 60Hz
- Confirm the change with Enter key, or go back without change with the LEFT arrow
- Press on the LEFT arrow to go back to the previous menu level

3-11 Calibration access code:

TRIGGER	AUTO
DATE	29/03/04
TIME	12:13
LANG	FRA
MAINS	50HZ
VERSION	VER 1.0
PASSCODE	>
CAL	

From the power ON screen only:


- Select the PASSCODE line
- Press on the RIGHT arrow or on the enter key.
- Enter your previous calibration passcode with the UP, DOWN, RIGHT, LEFT arrows.
- Enter the passcode with the Enter key
- Then enter your new passcode with the UP, DOWN, RIGHT, LEFT arrows.
- Enter the new passcode with the Enter key
- If you don't remember your passcode , please call CROPICO's service department on +44 (0) 191 587 8739

To perform a unit calibration, please refer to the Calibration manual.


3-12 DO7010 AUTOTEST:

At anytime the DO7010 auto-test function allows checking of the measurement accuracy.

From the power ON screen, press the TEST function key:

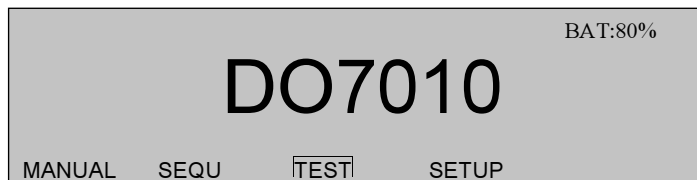

Then the DO7010 performs a checking routine and display the measurement result of a built-in 5 mΩ resistor.

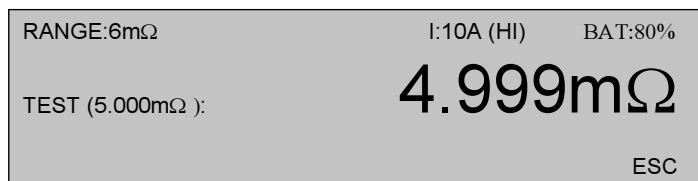

If the measurement result is within the tolerances (uncertainty of DO7010 unit + built-in resistor equal about +/- 19 digits) then the green LED lights, if not the red LED lights.


If red LED lights, we recommend to stop operating the unit and to send it back to our Service department for diagnostic.

SECTION 4: OPERATING THE DO7010 IN MANUAL MODE

The DO7010 MANUAL operating mode allows single measurement as any ordinary measurement unit.

In addition the DO7010 SEQUENCE operating mode performs measurement sequence according to saved protocol through PC download (see section 5)


From the power ON screen, press on the MANUAL function key to reach the MANUAL menu.

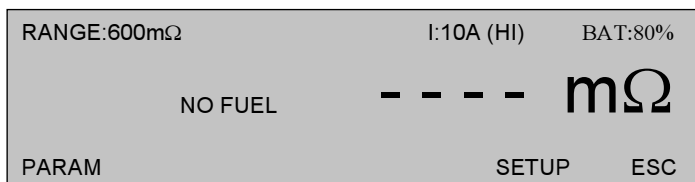

- The LCD screen upper line gives range and current parameters.
- After each power ON, those parameters will be reset to default values (60mΩ, 10A, ZERO mode) or memorized (according to manufacture setup).
- The **NO FUEL** message is displayed (according to manufacture setup) for current values :1A and 10A

4-1 MANUAL mode parameters:

- To change the measurement ranges, press on the UP or DOWN arrows.
- To change the other parameters, press on the PARAM function key.

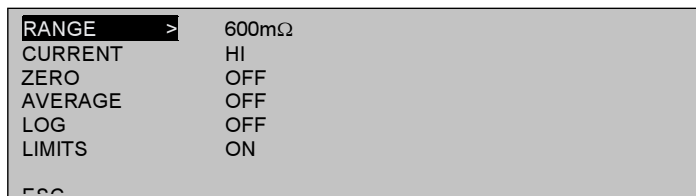

- With the UP and DOWN arrows, move the reverse video area to select the line to modify.
- With the RIGHT arrow or the enter key, enter in the menu level to set the parameters.

4-1-1 Measurement range selection:

RANGE	>	6000mΩ
CURRENT		600mΩ
ZERO		60mΩ
AVERAGE		6mΩ
LOG		AUTO1
LIMITS		AUTO2
		ESC

- Select the RANGE line
- Press on the RIGHT arrow or on the enter key .
- Select the measurement range with the UP and DOWN arrows:
 - 6000mΩ : from 0001 to 6000 mΩ
 - 600mΩ : from 000.1 to 600.0 mΩ
 - 60mΩ : from 00.01 to 60.00 mΩ
 - 6mΩ : from 0.001 to 6.000 mΩ
 - AUTO1 : automatic searching range from the highest range (6000mΩ).
 - AUTO2 : automatic searching range from the last measurement range.
- Enter the selection with the Enter key.

4-1-2 Measurement current selection:

RANGE		LO
CURRENT	>	HI
ZERO		
AVERAGE		
LOG		
LIMITS		
		ESC

- Select the CURRENT line
- Press on the RIGHT arrow or on the enter key.
- Select the measurement current with the UP and DOWN arrows:
 - HI = 10A for the 6 to 600mΩ ranges and 1A for the 6000 mΩ range.
 - LO = 1A for the 6 to 600mΩ and 0.1A for the 6000 mΩ range.
- Enter the selection with the Enter key.

4-1-3 Thermal EMF Error:

Putting in contact 2 metals from different material generates unwanted voltages (EMF) proportional to the ambient temperature.

When measuring low resistances, consequently low voltages, the accessories and specimen under test conductive metals can introduce significant errors.

Two methods exist to cancel this problem: the Zero method and the Average method. Both methods are available with the DO7010.

The ZERO method:



- Select the ZERO line
- Press on the RIGHT arrow or on the enter key.
- The Zero method consists of a voltage measurement without current, then a voltage measurement with current, and subtraction of EMF voltages before resistance calculation. Select with the UP and DOWN arrows:
 - ON = Zero method operating
 - OFF = Zero method not operating
- Enter the selection with the Enter key.

The AVERAGE method:



- Select the AVERAGE line
- Press on the RIGHT arrow or on the enter key.
- The Average method consists of a voltage measurement with a positive current, then a voltage measurement with negative current, and average of the 2 measurements to get the resistance calculation. Select with the UP and DOWN arrows:
 - ON = Average method operating
 - OFF = Average method not operating
- Enter the selection with the Enter key.

4-1-4 Log mode:

RANGE	OFF
CURRENT	ON
ZERO	REVIEW
AVERAGE	DELETE
LOG	>
LIMITS	
ESC	

- Select the LOG line
- Press on the RIGHT arrow or on the enter key.
- When the SEQUENCE mode is empty (no Sequence downloaded in the DO7010), the MANUAL mode allows storing up to 999 measurements with the measurement number, the resistance value, the current, the range, the time and the date.
- Select the Log mode with the UP and DOWN arrows:
 - OFF = no log mode
 - ON = log mode operating if no sequence loaded
 - REVIEW = to review the already stored values
 - DELETE = to delete the memory
- Enter the selection with the Enter key.

LOG#	Rx	RANGE	I	DATE	TIME

4-1-5 The limit function:

On the DO7010 in MANUAL mode a maximum and the minimum resistance values can be adjusted.

Within those 2 values, the measurement is correct (PASS), the green LED lights and the OK message is displayed on the LCD screen.

For values higher than the maximum limit or lower than the minimum limit the measurement is failed (FAIL), the red LED lights, a beep signal sounds and the message "HI" or "LO" is displayed on the LCD screen.


Limits adjustment:

RANGE	OFF	
CURRENT	ON	
ZERO	MIN	10mΩ
AVERAGE	MAX	3000mΩ
LOG		
LIMITS	>	

- Select the LIMITS line
- Press on the RIGHT arrow or on the enter key.
- Select the Limits mode and values with the UP and DOWN arrows:
 - OFF = limit function not operating
 - ON = limit function operating
 - MIN = adjust the minimum value from 0.001 to 6000 mΩ with the RIGHT arrow and then with the UP or DOWN arrows.
 - MAX = adjust the minimum value from 0.001 to 6000 mΩ with the RIGHT arrow and then with the UP or DOWN arrows.
- Enter the selection with the Enter key.
- Press on the LEFT arrow to come back to the previous menu level


4-2 Measurements in MANUAL mode:

- Trigger a measurement with the green push button on the battery pack front panel, or by making contact on the specimen under test with the probes (see trigger modes in section 3-6)
- If measurement probes or leads are not correctly connected to the specimen under test, the following error messages can be displayed :
 - “CIRCUIT INCOMPLETE CHECK +VE CABLES”
 - “CIRCUIT INCOMPLETE CHECK -VE CABLES”
 - “RESISTANCE TOO HIGH IN CURRENT LEADS”

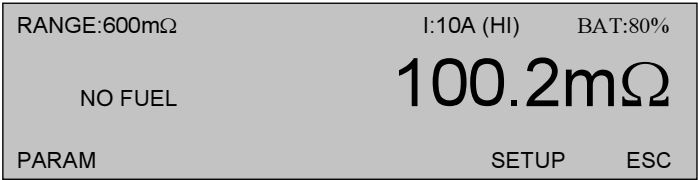

4-3 Measurements in MANUAL mode with the limit function:

- Set the LIMITS mode (see chapter 4-1-5) and trigger a measurement with the green push button on the battery pack front panel, or by making contact on the specimen under test with the probes.
- If the measurement result is :
 - Within the limits, the display shows : **OK**
 - Lower than the low limit, the display shows : **LO**
 - Higher than the high limit, the display shows : **HI**

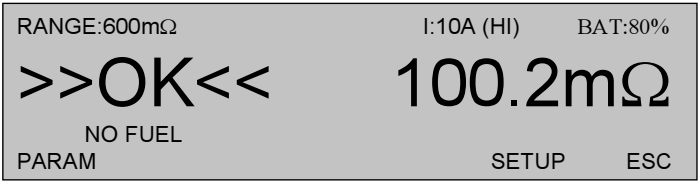

4-4 Measurement in MANUAL mode with the log mode:

WARNING: this feature is only available if there is no Sequence downloaded in the DO7010 (see chapter 5). To delete the loaded sequence, please refer to the DO7010-PRO software manual.

- Set the Log mode (see section 4-1-4) and trigger a measurement with the green push button on the battery pack front panel, or by making contact on the specimen under test with the probes.
- Each of the measurements will be stored together with the range, current, date, and time.
- To review the measured values:
 - Press on the PARAM function key
 - Select the LOG line
 - Press on the Enter key
 - Select the REVIEW line
 - Press on the Enter key
 - The LCD screen shows the values as follows:

LOG#	Rx	RANGE	I	DATE	TIME
1	10.01	60	HI	19/07/04	13 :14
2	10.03	60	HI	19/07/04	13 :15
3	10.01	60	HI	19/07/04	13 :16
4	10.05	60	HI	19/07/04	13 :17
5	10.01	60	HI	19/07/04	13 :18

- Scroll the values with the DOWN or UP arrows.
- Escape this menu with the ESC function key.

To delete all the saved measurements:

- Press on the PARAM function key
- Select the LOG line
- Press on the Enter key
- Select the DELETE line
- Press on the Enter key
- Confirm the delete by selecting the CONFIRM line
- Press on the Enter key.
- Select the CANCEL line to stop delete operation
- Press on the Enter key

SECTION 5: SEQUENCE MODE

The measurement protocols are made with the DO7010 software. This software operates on a PC computer with Excel format files.

Files are downloaded to the DO7010, then after complete or partial measurement performing, the files with the measurement data are uploaded from the DO7010 to the PC computer.


File example with measurement protocol description:

MSM aeroplane	AV								
	1234567								
Reference	A6/789								
Range	Number	Nominal mOhm	Current (A)	Measurement value	Result	Date	Time	Operating ID	Serial no.
ABCDE0123456789	1	500,0	10	423,5	Pass	16.12.03	14:00	A6/123	201
	2	500,0	10	438,8	Pass	16.12.03	14:01	A6/123	201
	3	500,0	10	454,1	Pass	16.12.03	14:02	A6/123	201
	4	500,0	10	469,4	Pass	16.12.03	14:05	A6/123	201
	5	500,0	10	484,7	Pass	16.12.03	14:10	A6/123	201
	6	500,0	10	500,0	Pass	16.12.03	14:11	A6/123	201
	7	500,0	10	515,3	Fail	16.12.03	14:12	A6/123	201
	8	500,0	10	530,6	Fail	16.12.03	14:13	A6/123	201
BBCDE0123456789	1	30,00	1	41,23	Fail	16.12.03	15:00	A6/456	201
	2	30,00	1	38,73	Fail	16.12.03	15:02	A6/456	201
	3	30,00	1	36,23	Fail	16.12.03	15:04	A6/456	201
	4	30,00	1	33,73	Fail	16.12.03	15:06	A6/456	201
	5	30,00	1	31,23	Fail	16.12.03	15:08	A6/456	201
	6	30,00	1	28,73	Pass	16.12.03	15:10	A6/456	201
	7	100,0	10	120,5	Fail	16.12.03	15:12	A6/456	201
	8	100,0	10	115,1	Fail	16.12.03	15:14	A6/456	201
	9	100,0	10	109,7	Fail	16.12.03	15:16	A6/456	201
	10	100,0	10	104,3	Fail	16.12.03	15:18	A6/456	201
	11	100,0	10	98,9	Pass	16.12.03	15:20	A6/456	201
	12	100,0	10	93,5	Pass	16.12.03	15:22	A6/456	201
	13	100,0	10	88,1	Pass	16.12.03	15:24	A6/456	201
	14	100,0	10	82,7	Pass	16.12.03	15:26	A6/456	201
	15	100,0	10	9999	Absent	16.12.03	15:28	A6/456	201
	16	100,0	10	8888	Absent	16.12.03	15:30	A6/456	201
CBCDE0123456789	1	500,0	10	7777	No reply				
	2	500,0	10	7777	No reply				
	3	500,0	10	7777	No reply				
	4	500,0	10	7777	No reply				
	5	500,0	10	7777	No reply				

For more information, please refer to the DO7010-PRO software manual


- After sequence file download, and from the initialisation menu, press on the SEQU function key

If no Sequence file has been downloaded the following error message is displayed
« NO SEQUENCE FILE LOADED ».

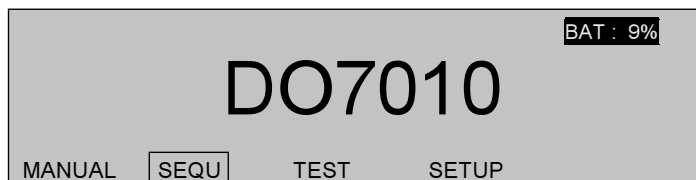

5-1 Measurement protocol selection:

A sequence is made with several measurement protocols (or series). Each measurement protocol describes a series of measurements to be performed with the physical location or part number and test parameters (current, resistance threshold) for every test points.

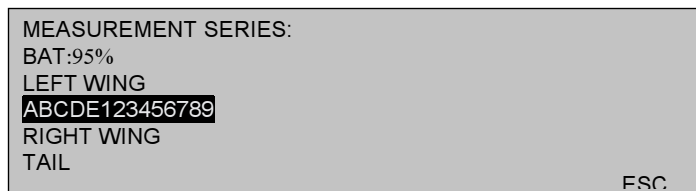

- Select the measurement protocol by setting in reverse video the line with UP or DOWN arrows.
- Enter the selection with the Enter key.

5-2 Measurement protocol header display:

ABCDE123456789		BAT:90%
DATE :	04 -12- 03	
TIME :	15:35	
OPERATOR :	A	
AIRCRAFT:	AV1234567	
		ESC


- Enter the operator code with the UP or DOWN arrows to scroll the numbers and the letters and with the RIGHT or LEFT arrows to select the characters position.
- Enter with the Enter key
- Check the aircraft number, and make correction if necessary with the A/C function key.
- Press on the NEXT function key to start the measurement protocol.

ABCDE123456789		BAT:90%
DATE :	04 -12- 03	
TIME :	15:36	
OPERATOR :	AB100	
AIRCRAFT:	AV1234567	
OPER A/C	NEXT	ESC


5-3 First measurement of the protocol:

ABCDE123456789		S:150.0mΩ	I:10A
BAT:90%			
001:		mΩ	
POINT	ABSENT	VALID	SET UP
		ESC	

- Trigger a measurement with the green push button on the battery pack front panel or by making contact on the specimen under test with the probes.
- **IMPORTANT:** in AUTO trigger mode, it is mandatory to have first an open circuit, then to make a contact with the probe on the specimen under test to trigger a measurement.

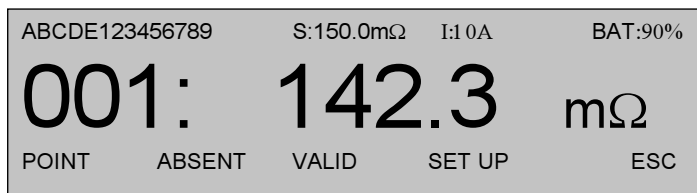5-3-1 Example for a PASS measurement:


If the measurement is lower than the limit, the green LED lights, the value is saved in the memory and the unit jumps automatically to the next protocol step.

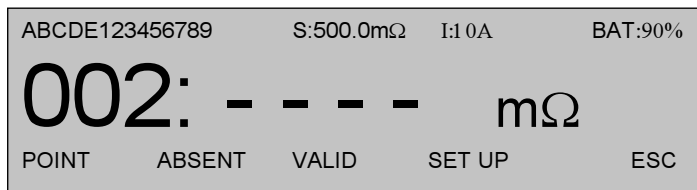


- The next measurement is the next protocol step which is either :
 - To Be Done = - - - - (= 7777 excel file)
 - Over = OVER (= 8888 excel file)
 - Absent = ABS (= 9999 excel file)
 - Fail = previous fail measurement
- The PASS measurements are skipped.

5-3-2 Direct access to a test step:


- Press on the POINT function key to set in flashing mode the point number enter area.
- Enter the point number with the UP or DOWN arrows to scroll the numbers and with the RIGHT or LEFT arrows to select the position.
- Enter the value with the Enter key.
- For a direct access to the first sequence point or to the last sequence point, use the RIGHT or LEFT arrows.
- **The direct access feature allows the operator to reach all the sequence points whatever their status (PASS,FAIL,TO BE DONE, ABSENT)**

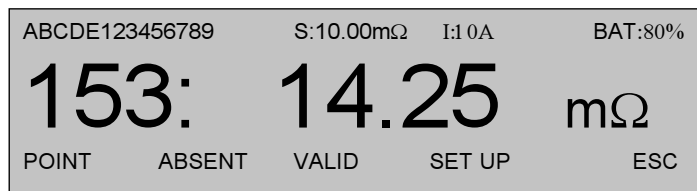5-3-3 Example for a FAIL measurement:

- Trigger a new measurement.
- If the value is higher than the limit, an audible signal (2 beeps) sounds, the red LED lights, and the DO7010 unit stays on the same test step.
- To re-test, trigger a new measurement either with the probe contact or the green front panel push button.
- To store a FAIL measurement, press on the VALID function key.
- Confirm the validation by pressing on the YES function key.
- Then the DO7010 unit jumps to the next test step.
- To cancel the FAIL confirmation, press on the NO function key and trigger a new measurement.

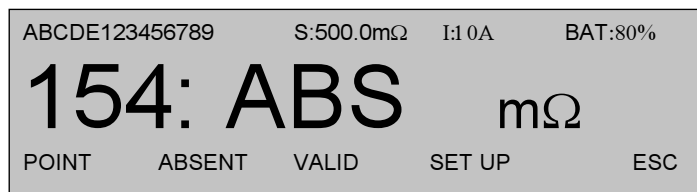5-3-4 Example for an ABSENT point:


- If a point to be measured is absent or non available for the measurement, then press on the ABSENT function key.
- Confirm the ABSENT status by pressing on the YES function key.
- Then the unit jumps to the next test step.
- To cancel the ABSENT confirmation, press on the NO function key and trigger a new measurement.

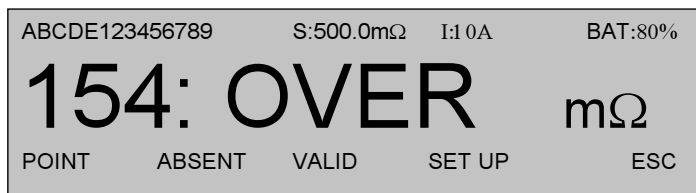5-3-4 Example of an OVER measurement:

- If the measurement is out of the unit ranges, an audible signal sounds, the red LED lights with above display.
- To re-test, trigger a new measurement either with the probe contact or the green front panel push button.
- To store the OVER status, press on the VALID function key.
- Confirm by pressing on the YES function key.
- Then the unit jumps to the next test step.
- To cancel the OVER confirmation, press on the NO function key and trigger a new measurement.

5-4 Sequence end:

After the last sequence measurement, the END message is displayed.
Press on the END function key to select the next measurement protocol.

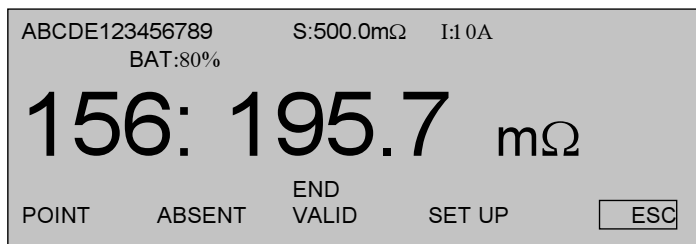

SECTION 6 SERVICE and CALIBRATION:

6.1 PRELIMINARY

Our warranty (refer to the beginning of this manual) attests the quality of materials and workmanship in our products. If malfunction should be suspected or other information is required, call our technical assistance: +44 (0) 191 587 8718.

6.2 INSTRUMENT RETURN

Before returning an instrument to our Service Department, please contact us for shipment instructions. Use packaging that is adequate to protect it from damage.

6.3 SERVICE

Our units don't need particular service, except an annual calibration. If you encounter any problems, please follow the brief check list below. If the problem continues, please contact our service department.

- **LCD SCREEN DOESN'T COME UP:**
 - Check that the battery block is correctly fitted into the DO7010 unit.
 - Recharge the battery block for at least 3 hours.

Other reasons for malfunction requires intervention inside the unit by qualified people. However we can supply a service manual including schematics of our units. Please contact our Service department for price and delivery time.

6.4 CLEANING

Clean the instrument with a damp cloth.

6.5 CALIBRATION

We recommend calibrating our units each year. The calibration must be performed by qualified people following the appropriate procedure and correct standards. Our service and calibration department is at your service to perform the annual calibration. Please contact us to request cost and return times.

For Technical Support Contact:

Tel: +44 (0) 191 587 8718

For Service and Calibration Contact:

Service Department
Seaward Group
Unit 11
Bracken Hill
South West Industrial Estate
Peterlee
Co Durham
SR8 2LS
England

Tel: +44 (0) 191 587 8739

Fax: +44 (0) 191 587 8737

E-mail: service@seaward.co.uk

CROPICO is a division of



Additional Products From Cropico

DIGITAL OHMMETERS

RESISTANCE BRIDGES

RESISTANCE DECADE BOXES

RESISTANCE STANDARDS

DIGITAL THERMOMETERS

THERMOCOUPLE SIMULATORS

INSULATION TEST SETS

PT100 SIMULATORS

UNIVERSAL CALIBRATORS

HIPOT TESTERS

ELECTRICAL SAFETY TESTERS



Phone, fax or e-mail for further information on the above or for a copy of our general catalogue: - Phone: - +44 (0) 191 5863511
Fax: - +44 (0) 191 5860227

E-mail:- **sales@cropico.co.uk**

Website: - **www.cropico.co.uk**

